

AIRCRAFT INSPECTION REPORT

OWNER Amelia Earhart
ADDRESS 50 West 45th Street, New York N.Y.
Original license—Renewal—Export—Alteration (submit drawings)—Special After accident of _____ (Date)
Manufacturer Lockett Aircraft (Circle which) Model 10E Specification No. _____
Open cabin—Amphibian—Landplane—Seaplane—Flying boat—Biplane—Monoplane—Autogiro—Glider.
(Circle which)

ENGINES

MANUFACTURER	LOCATION	MODEL	SPEC. NO.	SERIAL NO.	H. P.
<i>Rocky Mountain</i>	<i>Overhead Taping Machine</i>	<i>S3H1</i>	<i>143</i>	<i>15 6149</i> <i>10 6150</i>	<i>550</i> <i>550</i>

PROPELLER

PROPELLER			HUBS—SPEC. No. <u>257</u>		BLADES—SPEC. No. <u>301</u>	
MANUFACTURER	LOCATION	MATERIAL	Model	Serial No.	Model	Serial No.
<u>Hamilton -</u>	<u>Cuthbert</u>	<u>White</u>	<u>12D40-11</u>	<u>26234</u>	<u>405A-1</u>	<u>53533-34</u>
<u>Standard</u>	<u>Mt. Vernon</u>			<u>26333</u>		<u>53531-32</u>

Number of fuel tanks 12 Location and capacity of each 6 Fuses 132-132-81-81-16-16-16-16-115-115-149-149-149-149 gal Total oil capacity 64 gal
 Passenger seats actually provided — Crew 2 Are dual controls installed? Yes Removable? Yes
 Weight empty as equipped—Actual—Computed — pounds. Gross weight 10,500 pounds.
 (Circle which)
 Maximum pay load — pounds with fuel of — gallons.
 Maximum pay load — pounds with full fuel tanks of 1151 gallons.
 Cargo space—Location and capacity of each 1 Aft of Cabin.

Are compartments placarded for loads as shown?

Restrictions

ALL EQUIPMENT AND WEIGHTS thereof included in empty weight MUST BE SHOWN

ALL EQUIPMENT AND WEIGHTS thereof included in empty weight MUST BE SHOWN.			
2 Engine ring cowl	X lb.	2 Flares and holders	2 min. X lb.
2 Starter (type?)	Electric X lb.	Location	Nose of Ship.
1 Generator	X lb.	Radio	W E Trans & Rec X lb.
Wheel streamlines	lb.	Location	Trans rear of cabin Rec. in cockpit seat.
1 Battery	X lb.	Radio bonding	X lb.
Location	4th Pilot's Seat	Radio shielding	X lb.
2 Landing lights	X lb.	Water container	lb.
		Fire extinguisher	2-140nd. Pressure X lb.
		Heater	X lb.
		Toilet equipment	lb.
		Bendix Radio compass	lb.
		rear of co-pilot's seat	lb.
		in cabin.	X lb.

If inspection after accident, underscore classification which applies:

1. Major repair (see Aero. Bulletin 7-H—Current Issue). Attach Form 466.
2. Minor repair (see Aero. Bulletin 7-H—Current Issue).

IMPORTANT.—All questions must be fully answered. O. K. or check marks will not be accepted. Disapprovals must show specific defects

PILOT'S COCKPIT.—Are airspeed indicator, manifold pressure gauge, and tachometer mark to agree with placarded aircraft operation limits as listed on pertinent aircraft specifications? Yes Yes No — (If not, see that they are properly marked at once. Cross out items not required to be marked.) Approved safety belt installed each seat? Yes

PASSENGER'S COMPARTMENT.—Approved safety belt installed each seat? —

Seats Installed - as per diagram.

STABILIZER, ELEVATORS, AND RUDDER.—Approved position light? Yes

LANDING GEAR WHEELS (Manufacturer, model, and size) Goodyear Air wheels.

Tires (size and ply) Goodyear Air 35 X 15-6 6 ply.

Shock struts (manufacturer and model) Lockheed Electro Model 10

Tail wheel (manufacturer, model, and size) Goodyear air wheel 15 X 7-3 Tail skid —

Skis (manufacturer, model, and weight) —

Floats (manufacturer and model) —

CENTER SECTION AND FUSELAGE

WINGS

Left lower OK

Left upper —

Right lower OK

Approved position lights? Yes

Right upper —

Approved position lights? Yes

POWER PLANT AND INSTALLATION

Total aircraft flight time 74:00

Flight time since overhaul —

Total engine time 82:42

Flight time since engine change or overhaul —

Total propeller time 82:42

Flight time since propeller disassembly and inspection —

REMARKS:

Inspected by original mfg.

NOTE.—If space provided is insufficient for full statement of result of inspection, additional data may be shown on extra sheet.

OFFICE HEADQUARTERS
FIRST INSPECTION DISTRICT
ROOSEVELT FIELD No. 1
GARDEN CITY, LONG ISLAND
NEW YORK

DEPARTMENT OF COMMERCE

AERONAUTICS BRANCH


BUREAU OF AIR COMMERCE

GARDEN CITY

IN REPLY REFER TO

FILE

DEC 28 11 08:35
RECEIVED
INFORMATION

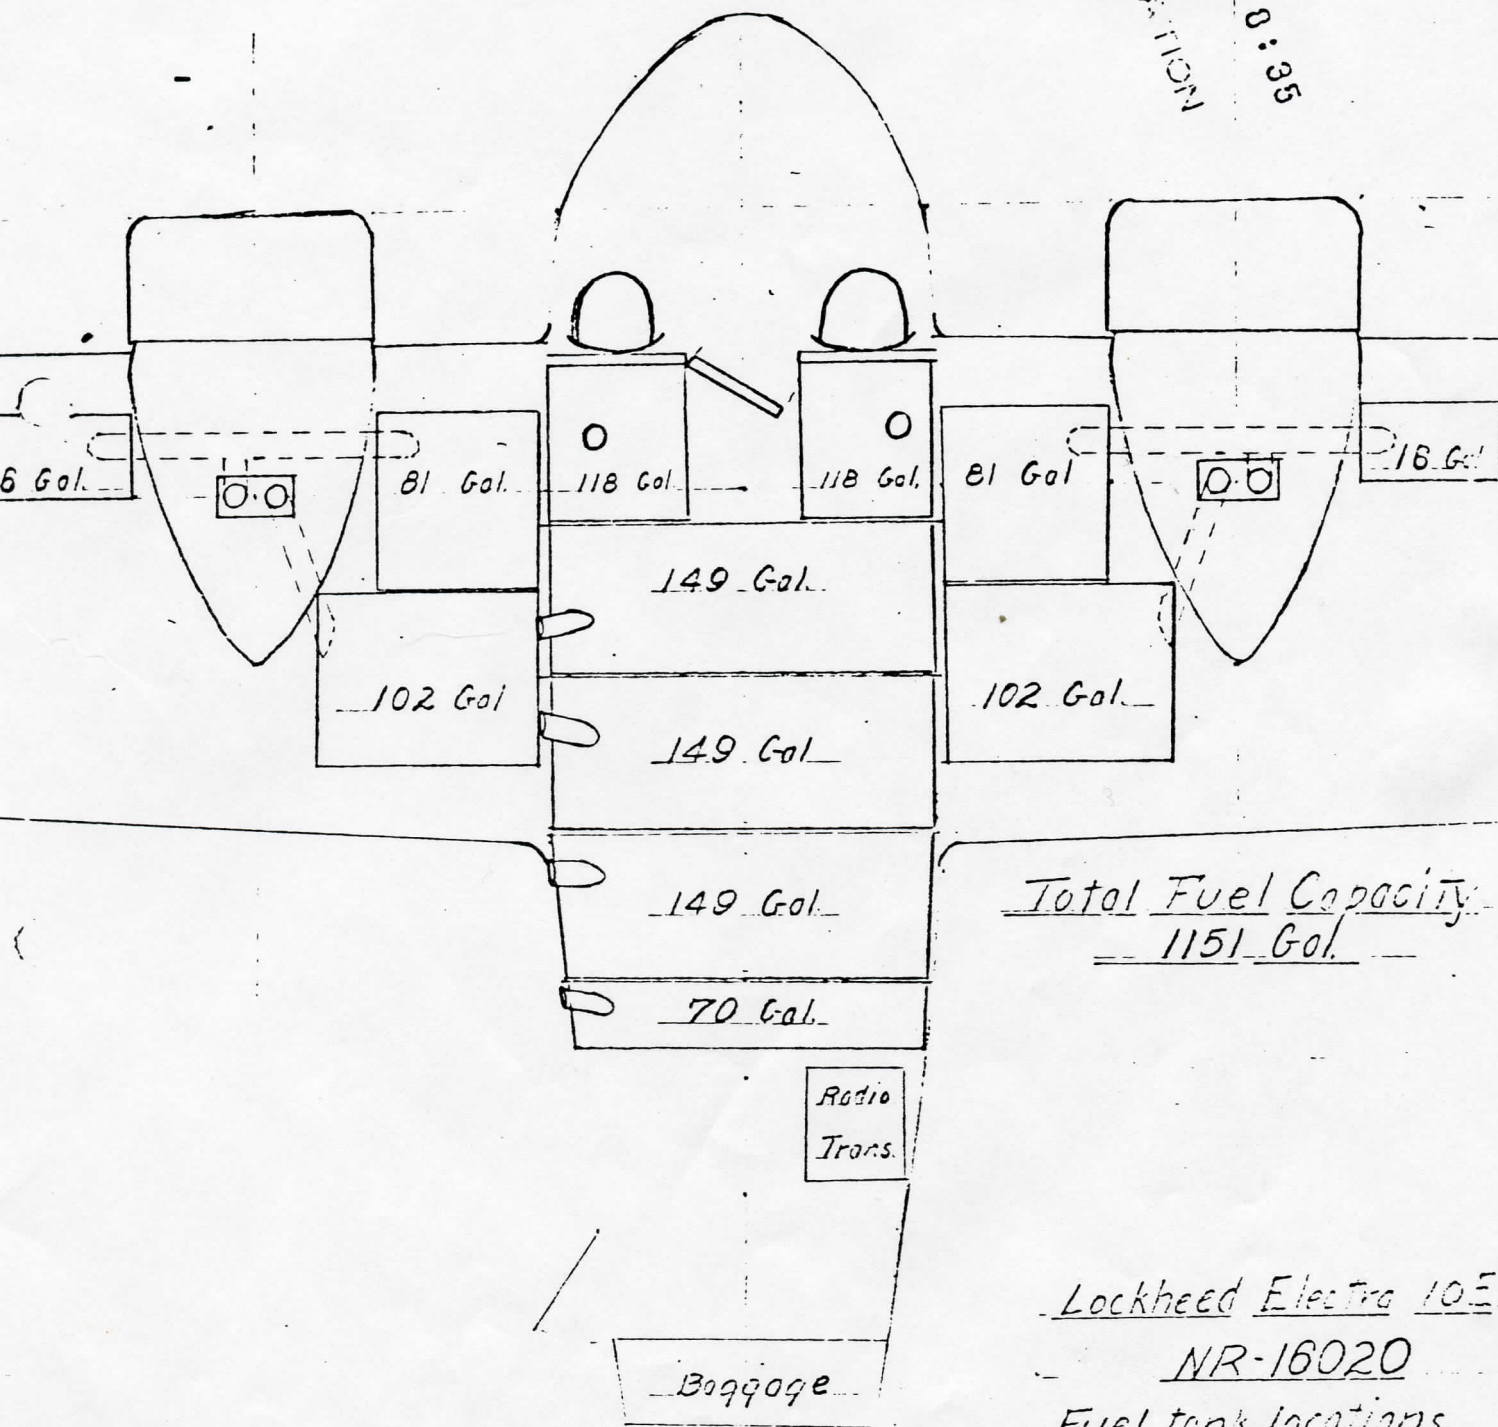

31